










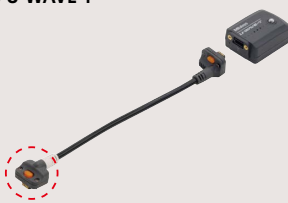



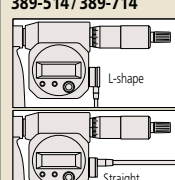
Measurement Data Management

Digimatic Data Cable Selector (including USB Input Tool Direct)

1) USB Input Tool Direct USB-ITN 	Connector type	A) Water-proof type with output button	B) Water-proof type with output button	C) Straight type with output button	CR) L type with output switch (cable outlet is right)	D) Flat 10-pin type	
	Model No. Order No.	USB-ITN-A 06AFM380A	USB-ITN-B 06AFM380B	USB-ITN-C 06AFM380C	No applicable models USB-ITN-C is available Refer to the following figure.	USB-ITN-D 06AFM380D	
2) IT-020U/IT-007R/DP-1VA LOGGER/MUX-10F/EC Counter  Connector (12 types, A to G and SF) Type D on the other end for all models	Connector type	A) Water-proof type with output button	B) Water-proof type with output button	C) Straight type with output button	CR) L type with output switch (cable outlet is right)	D) Flat 10-pin type	
	Order No.	1 m	05CZA624	05CZA662	959149	04AZB512	936937
		2 m	05CZA625	05CZA663	959150	04AZB513	965014
3) U-WAVE-T 	Connector type	A) Water-proof type with output button	B) Water-proof type with output button	C) Straight type with output button	CR) L type with output switch (cable outlet is right)	D) Flat 10-pin type	
	Standard	02AZD790A	02AZD790B	02AZD790C	No applicable models Type C connectors are available, but take care of the cable when using thimbles Refer to the following figure.	02AZD790D	
	For foot switch	02AZE140A	02AZE140B	02AZE140C		02AZE140D	












Select a cable (A to G and SF) whose gage connector fits the Digimatic port on your gage (check the red dotted frame in the above pictures).

Gage connectors on data cable The connector dimensions are given on page A-23.	Connector type	A) Water-proof type with output button	B) Water-proof type with output button	C) Straight type with output button	CR) L type with output switch (cable outlet is right)	D) Flat 10-pin type
	Picture of gage connector					
	Data switch	Available	Available	Available	Available	N/A

Digimatic ports on gage Please note that some high-precision Digimatic gages are capable of displaying the measurement result to more than 6 digits. However, according to the Digimatic output specification, the result may be output in 6 digits only. Digimatic gages whose display may exceed 6 digits <ul style="list-style-type: none"> • Laser Scan Micrometers • Litematic • Linear gage counter (EH) 	Picture of Digimatic port					
	Applicable models	<ul style="list-style-type: none"> • Digimatic caliper 500-776 / 500-777, etc. 500-712-20 / 500-713-20, etc. 500-712 etc. • Digimatic special application caliper 550-301-10 / 550-331-10, etc. 551-301-10 / 551-331-10, etc. 552-302-10 / 552-303-10, etc. 552-150-10 / 552-151-10, etc. 552-155-10 / 552-156-10, etc. 552-181-10 / 552-182-10, etc. • Digimatic special application caliper 573-601 / 573-602, etc. • Digimatic depth gage 571-251-10 / 571-252-10, etc. • Digimatic scale unit 572-600, 572-601, etc. 	<ul style="list-style-type: none"> • Digimatic micrometer 293-140-30 / 293-141-30, etc. 293-230-30 etc. • Digimatic micrometer 340-251-30 / 340-252-30 293-666-20 / 293-667-20, etc. 227-201-20 / 227-203-20, etc. 227-205-20 / 227-206-20, etc. 227-221-20 etc. 227-223-20 etc. • Dedicated micrometers for Digimatic 422-230-30 / 422-231-30, etc. 406-250-30 / 406-251-30, etc. 343-250-30 / 343-251-30, etc. 369-250-30 / 369-251-30, etc. 345-250-30 / 345-251-30, etc. 314-251-30 / 314-252-30, etc. • Digimatic micrometer head 350-251-30 / 350-261-30, etc. • Digimatic holtest 468-161 / 468-162, etc. • Digimatic depth gage 329-250-30 / 329-251-30, etc. 	<ul style="list-style-type: none"> • Digimatic caliper 500-150-30 / 500-151-30, etc. 500-500-10 / 500-501-10, etc. 500-443 etc. • Digimatic special application caliper 573-118-10 / 573-119-10, etc. 573-116-10 / 573-117-10, etc. 573-191-30 / 573-291-30 573-181-30 / 573-182-30, etc. • Digimatic depth gage 571-201-30 / 571-202-30, etc. • Digimatic micrometer head 164-163 / 164-164 • Digimatic scale unit 572-203-10 / 572-213-10 572-300-10 / 572-301-10, etc. 	<ul style="list-style-type: none"> • Digimatic micrometer 293-582 / 293-583, etc. 389-514 / 389-714  <p>Type C straight connectors are available, but may interfere with thimble operation.</p>	<ul style="list-style-type: none"> • Digimatic indicator ID-H ID-F (Note1) • High-precision height gage QM-Height • Mu-checker Digital Mu-checker (using a foot switch) • Laser scan micrometer LSM-9506 • Linear gage counter EF / EH (Note 2) EB (Note 1), EC-101D (Note 1) • Litematic VL-50-B / 50S-B (Note 2) • Contour measuring system SJ-210 / 310 / 410 SJ-500 / SV-2100 (Note 2) • Hardness testing machines HM-210 / 220 HV-110 / 120 HR-530 HR-600

E) Round 6-pin type	F) Flat straight type	FB) Flat L-shape (cable outlet is back)	FR) Flat L-shape (cable outlet is right)	FL) Flat L-shape (cable outlet is left)	G) Flat straight water-proof type	SF) Straight standard type
USB-ITN-E 06AFM380E	USB-ITN-F 06AFM380F	No applicable models USB-ITN-F is available.			USB-ITN-G 06AFM380G	USB-ITN-SF 06AGQ001F
E) Round 6-pin type	F) Flat straight type	FB) Flat L-shape (cable outlet is back)	FR) Flat L-shape (cable outlet is right)	FL) Flat L-shape (cable outlet is left)	G) Flat straight water-proof type	SF) Straight standard type
937387	905338	905689	905691	905693	21EAA194	06AGL011
965013	905409	905690	905692	905694	21EAA190	06AGL021
E) Round 6-pin type	F) Flat straight type	FB) Flat L-shape (cable outlet is back)	FR) Flat L-shape (cable outlet is right)	FL) Flat L-shape (cable outlet is left)	G) Flat straight water-proof type	SF) Straight standard type
02AZD790E	02AZD790F	No applicable models Use 02AZD790F or 02AZD140F .			02AZD790G	02AZG011
02AZE140E	02AZE140F				02AZE140G	02AZG021

! Note 1: **ID-F, EB, EC-101D, ID-U, ID-SS, ID-SX** are required to use with the **USB-ITN**.
 Note 2: **USB-ITN, IT-020U,** and **U-WAVE** cannot be used with **EF/EH, VL-50-B/50S-B,** and **SJ-500/SV-2100**.

E) Round 6-pin type	F) Flat straight type	FB) Flat L-shape (cable outlet is back)	FR) Flat L-shape (cable outlet is right)	FL) Flat L-shape (cable outlet is left)	G) Flat straight water-proof type	SF) Straight standard type
						
N/A	N/A	N/A	N/A	N/A	N/A	N/A
		← ← ←				
<ul style="list-style-type: none"> • Hardness testing machines HM-102 HM-103 HM-320 HM-430 HM-411 	<ul style="list-style-type: none"> • Digimatic indicator ID-CX, ID-C (Peak-Value Hold Type), ID-C (Calculation type), ID-C (Bore Gage Type), ID-U (Note 1), ID-SS (Note 1), ID-SX (Note 1) • Digimatic height gage 192-663-10/192-613-10/570-322/570-227 • ABS borematic 568-361/568-362, etc. • Scale unit 572-460/572-560/572-480-10/572-580-10, etc. 	<ul style="list-style-type: none"> • Digimatic bore gage 511-501/511-502, etc. • Hardness testing machines HH-300 • Digimatic depth gage Digimatic type (ID-CX) 			<ul style="list-style-type: none"> • Digimatic indicator ID-N ID-B 	<ul style="list-style-type: none"> • Digimatic indicator ID-CNXX ID-FNX